

TABEL CU DEFECTELE CONSTATATE SI LUCRARILE DE REPARATII LA STALPII LEA 110 KV COZLA - SF. ELENA - MOLDOVA NOUĂ (Anexa 1.a.)

Nr. crt. /nr.st	TIP STALP	DIST. INTRE PICIOARE (m)	DEFECTE CONSTATATE LUCRARI DE EXECUTAT	DIMENS. CACIULA LxlxH(cm)	FELUL LUCRARII DE REPARATII				OBS.
					Curatat acces stalp (m ²)	SAPAT (m ³)	BETON -B200 (m ³)	TENCUIELI SCLIVISITE (m ²)	
0	1	2	3	4	5	6	7	8	9
1. /238	ITn110241 D.C.	3,4x5,0	-curatat lastaris-iedera; sapat decop 4caciuli+sapat pt evac. ape;-refac scliviseala-5mm ; <u>p.p.RUGINITA</u> ; - baza st.ruginita-curatat de rugina si vopsit baza st.	60x60xh=15	50,0	4,0		5,0	-ampl.linga statie , in ripa ; -refacere numerotare stalpi, montare tablite ;
2. /237	ICn 110231 D.C.	3,4x2,5	-defrisari locale-40m ² ;sap.pt decop.2caciuli; buciardat tenc det.;-ref tenc sclivisite ; <u>-p.p.RUGINITA</u> si iesita din fundatie ;	2-40x40-h=50 2-40x40-h=15	-40,0 /400	3	-	3,9	-amplas in padure, teren panta , ; -defrisari culoar intre st 2-1 ;
3. /236	ICn110231 D.C.	3,5x3,5	-defrisari locale-40m ² ;sap.pt decop.2caciuli; buciar. tenc det.;-ref tenc sclivisite 5mm ; <u>-p.p.RUGINITA</u> ; -; baza st.ruginita-curtat de rugina si vopsit baza st.	60x60-h=40	-40,0 /400	3	-	3,6	-amplas in padure, virf deal, linga vechi drum de la executie ; -defrisari culoar intre st 3-2
4. /235	ICn 110231 D.C.	3,4x5,0	-defrisari locale-50m ² ;sap.pt decop.4caciuli; buciar. tenc det.;-ref tenc scliv. la contact cu pamant; <u>-p.p. RUGINITA</u> ; -;baza st.ruginita-curtat de rugina si vopsit baza st.	75x75-h=70	-40,0 /800	4	-	8,4	-amplas in padure, teren panta, linga vechi drum de care ; -defrisari culoar intre st 4-3
5. /234	Sn110231 D.C.	2,6x3,4	-defrisari locale-40m ² ;sap.pt decop.caciuli; buciar. tenc det.;-ref tenc scliv. 5mm ; <u>-p.p. RUGINITA</u> ; -;baza st.ruginita-curtat de rugina si vopsit baza st.	50x50-h=25	-40,0 /800	3	-	8,4	-amplas in padure, teren panta, -defrisari culoar intre st 5-4
6. /233	ICn110231 D.C.	3,5x3,5	-defrisari locale-50m ² ;sap.pt decop.caciuli+rigola ape; buciar. tenc det.;-ref tenc scliv. 5mm ; <u>-p.p. RUGINITA</u> ; -;baza st.ruginita-curtat de rugina si vopsit baza st.	60x60-h=50	-40,0 /800	2	-	5,0	-amplas in padure, teren panta, -defrisari culoar intre st 6-5
7. /232	ICn110231 D.C.	3,5x3,5	-defrisari locale-40m ² ;sap.pt decop.caciuli; buciardat tenc det.;-ref tenc sclivisite 5mm ; <u>-p.p.RUGINITA</u> ; - baza st.ruginita-curtat de rugina si vopsit baza st. -c.vantuiri-3buc lipsa- sudat L50x50x5	-40x40-h=70	-40,0 /400	2	-	5,0	-amplas in padure, teren in panta , acces greu ; -defrisari culoar intre st 7-6
8. /231	ITn110240 D.C.	4,5x4,5	-defrisari locale iedera-50m ² ;sap.pt decop.caciuli si elem.compens.; buciardat tenc det.;-ref tenc sclivisite 5mm ; <u>-p.p.RUGINITA</u> ; -baza st.ruginita-curtat de rugina si vopsit baza st. si elem. compensare triunghi-zabreluta	-50x50-h=50	-50,0 /400	5	-	4,0	-amplas in padure, teren in panta , la cca 80m drum pt care ; -defrisari culoar intre st 8-7
9. /	Sn-	2,6x2,6	-defrisari locale-40m ² ;sap.pt decop.caciuli si elem.compens.; buciardat tenc det.;-ref tenc sclivisite 5mm ; <u>-p.p.RUGINITA</u> ; -baza st.ruginita-curtat de rugina si vopsit baza st. si elem. compensare triunghi-zabreluta	-40x40-h=50	-40,0 /400	4	1,0	4,0	-amplas in padure, teren in panta , la cca 80m drum pt care ; -defrisari culoar intre st 9-8

TABEL CU DEFECTELE CONSTATATE SI LUCRARILE DE REPARATII LA STALPII LEA 110 kV COZLA - SF. ELENA - MOLDOVA NOUĂ (Anexa 1.a)

Nr. crt. /nr.st	TIP STALP	DIST. INTRE PICIOARE (m)	DEFECTE CONSTATATE LUCRARI DE EXECUTAT	DIMENS. CACIULA LxIxH(cm)	FELUL LUCRARII DE REPARATII				OBS.
					Curatat acces stalp (m ²)	SAPAT (m ³)	BETON -B200 (m ³)	TENCUIELI SCLIVISITE (m ²)	
0	1	2	3	4	5	6	7	8	9
			-c.vantuire.-X-taiat; refacere sudura cu L50x50x5						
10. /	Sn-	2,6x2,6	-defrisari locale-50m ² ;sap.pt decop.caciuli; buciardat tenc det.;-ref tenc sclivisite 5mm ; -p.p.RUPTA; baza st.ruginita-curtat de rugină si vopsit baza st.	-40x40-h=60	-50,0 /300;400	2	-	4,0	-amplas in padure, la 20m drum care -defrisari culoar catre st 9 si 10
11. /	Sn-	2,6x2,6	-defrisari locale-30m ² ;sap.pt decop.2caciuli; buciar. tenc det.;-ref tenc sclivisite 5mm ; -p.p.RUGINITA; -baza st.ruginita-curtat de rugină si vopsit baza st. -c.vantuire.-X-taiat; refacere sudura cu L50x50x5	2-40x40-h=70 2-40x40-h=40	-30,0 /400	2	-	3,6	-amplas in padure, teren panta, linga drum care ; -defrisari culoar intre st 11-12
12. /	Sn	2,6x2,6	-defr.-30m ² si culoar LEA; sap.pt. decop.3caciuli; .;-ref tenc sclivisite 5mm; -p.p.RUGINITA; -baza st.ruginita-curtat de rugină si vopsit baza st.	2-40x40-h=80 2-40x40-h=40	-30,0 /400	3,0	-	3,9	-amplas in padure, teren panta, linga drum care;-defr.culoar intre st 12-13
13. /	Sn	2,6x2,6	-defrisari locale-40m ² ;sap.pt decop.2caciuli; buciardat tenc det.;-ref tenc sclivisite ; -p.p.RUGINITA; - baza st.ruginita-curtat de rugină si vopsit baza st.	2-40x40-h=70 2-40x40-h=50	-40,0 /400	2	-	3,9	-amplas in padure, teren panta, linga drum pt care ; -defrisari culoar intre st 13-14
14. /	Sn	2,6x2,6	-defrisari locale-40m ² ;sap.pt decop.caciuli; buciardat tenc det.;-ref tenc sclivisite 5mm ; -p.p.RUGINITA; - baza st.ruginita-curtat de rugină si vopsit baza st.	50x50-h=50	-40,0 /400	2	-	4,0	-amplas in padure, teren panta, la5m de drum pt care ; -defrisari culoar intre st 14-15
15. /	Sn	2,6x2,6	-defrisari locale-50m ² ;sap.pt decop.3caciuli; buciardat tenc det.;-ref tenc sclivisite ; -p.p.RUGINITA; - baza st.ruginita-curtat de rugină si vopsit baza st.	2-40x40-h=60 2-40x40-h=30	-50,0 /400	3	-	3,9	-amplas in padure, teren panta, ; -defrisari culoar intre st 15-16 ;
16. /	Sn	3,0x3,0	-defrisari locale-40m ² ;sap.pt decop.caciuli; buciardat tenc det.;-ref tenc sclivisite ; -p.p.RUGINITA; - baza st.ruginita-curtat de rugină si vopsit baza st.	2-40x40-h=70 2-40x40-h=50	-40,0 /400	3	-	3,9	-amplas in padure in ripa !!! ; -defrisari culoar intre st 16-17 ; -st are contra greutate
17. /	Sn	2,6x2,6	-defrisari locale-40m ² ;sap.pt decop.3caciuli; buciardat tenc det.;-ref tenc sclivisite ; -p.p.RUGINITA;	1-40x40-h=70 1-40x40-h=50 2-40x40-h=30	-40,0 /500	3	-	3,9	-amplas in padure, teren panta mare!! -defrisari culoar intre st 17-18 ;
18. /	ITn11024	4,1x4,1	-defrisari locale-40m ² ;sap. decop.caciuli-rigola ape; -ref tenc sclivisite ; -p.p.RUGINITA; - baza st.ruginita-curtat de rugină si vopsit baza st.	60x60-h=70	-30,0 /400	3	-	6,8	-amplas in padure, varf deal ;la cca 60m drum pt care ; -defrisari culoar intre st 18-19 ;
19. /	Sn-	3,0x3,0	-defrisari locale-30m ² ; - ref tenc sclivisite ; -p.p.RUGINITA; - baza st.ruginita-curtat de rugină si vopsit baza st.	1-40x40-h=80 1-40x40-h=70 2-40x40-h=25	-30,0 /400	3	-	5,0	-amplas in padure, -defrisari culoar intre st 19-20 ;

TABEL CU DEFECTELE CONSTATATE SI LUCRARILE DE REPARATII LA STALPII LEA 110 kV COZLA - SF. ELENA - MOLDOVA NOUĂ (Anexa 1.a)

Nr. crt. /nr.st	TIP STALP	DIST. INTRE PICIOARE (m)	DEFECTE CONSTATATE LUCRARI DE EXECUTAT	DIMENS. CACIULA LxIxH(cm)	FELUL LUCRARII DE REPARATII				OBS.
					Curatat acces stalp (m ²)	SAPAT (m ³)	BETON -B200 (m ³)	TENCUIELI SCLIVISITE (m ²)	
0	1	2	3	4	5	6	7	8	9
20. /	Sn	2,6x2,6	defrisari locale-30m ² ;sap. decop.caciuli-rigola ape; - ref tenc sclivisite ; -p.p.RUGINITA; - baza st.ruginita-curtat de rugina si vopsit baza st.	40x40-h=70	-30.0 /500	-	-	4,5	-amplas in padure, -defrisari culoar intre st 20-21 ;
21. /	Sn	2,6x2,6	defrisari locale-40m ² ;sap. decop.2caciuli-; - ref tenc sclivisite ; -p.p.RUGINITA; - baza st.ruginita-curtat de rugina si vopsit baza st.	1-40x40-h=100 1-40x40-h=70 2-40x40-h=40	-40.0 /400	2	-	4,0	-amplas in padure, -defrisari culoar intre st 21-22 ;
22. /	Sn	2,6x2,6	defrisari locale-40m ² ;sap. decop.caciuli-; - ref tenc sclivisite ; -p.p.RUGINITA;	2-40x40-h=80 2-40x40-h=25	-40.0 /400	3	-	4,0	-amplas in padure, teren in panta -defrisari culoar intre st 22-23 ;
23. /	Sn	2,6x2,6	defrisari locale-40m ² ;sap. decop.caciuli-; - ref tenc sclivisite ; -p.p.RUGINITA; - baza st.ruginita-curtat de rugina si vopsit baza st.	2-40x40-h=60 2-40x40-h=25	-40.0 /400	3	-	3,1	-amplas in padure, teren in panta, la cca 70m de drum pt care ; -defrisari culoar intre st 23-24 ;
24. /	Sn	2,6x2,6	defrisari locale-40m ² ;sap. decopertat caciuli-; - ref tenc sclivisite 5mm ; -p.p.RUGINITA; - baza st.ruginita-curtat de rugina si vopsit baza st.	1-40x40-h=100 2-40x40-h=50 1-40x40-h=10	-40.0 /500	3	-	4,0	-amplas in padure, teren in panta, la cca 100m de drum pt care ; -defrisari culoar intre st 24-25 ;
25. /	Sn	2,6x2,6	defrisari locale-40m ² ;sap. decopertat 3caciuli-; - ref tenc sclivisite 5mm ; -p.p.RUGINITA; - baza st.ruginita-curtat de rugina si vopsit baza st.	1-40x40-h=70 3-40x40-h=25	-40.0 /500	3	-	4,0	-amplas in padure, teren in panta, -defrisari culoar intre st 25-26 ;
26. /	Sn	2,6x2,6	-defrisari locale iedera-40m ² ;sap. decop. 3caciuli-; - ref tenc sclivisite ; -p.p.Rupta si RUGINITA; - baza st.ruginita-curtat de rugina si vopsit baza st.	1-40x40-h=70 3-40x40-h=30	-40.0 /500	3	-	3,1	-amplas in padure, teren in panta -defrisari culoar intre st 26-27 ;
27. /	Sn	2,6x2,6	-defrisari locale iedera-40m ² ;sap. decop. 3caciuli-; - ref tenc sclivisite ; -p.p.RUGINITA; - baza st.ruginita-curtat de rugina si vopsit baza st.	1-40x40-h=70 3-40x40-h=20	-40.0 /500	3	-	3,1	-amplas in padure, -defrisari culoar intre st 27-28 ;
28. /	Sn	2,6x2,6	-defrisari locale -40m ² ;sap. decop. caciuli-; - ref tenc sclivisite ; -p.p.RUGINITA;	2-40x40-h=60 2-40x40-h=50	-40.0 /500	2	-	3,6	-amplas in padure, panta mare -defrisari culoar intre st 28-29 ;
29. /	Sn	2,6x2,6	-defrisari locale -40m ² ;sap. decop. caciuli-; - ref tenc sclivisite ; -p.p.RUGINITA;	40x40-h=40	-40.0 /500	3	-	3,0	-amplas in padure, teren greu acces -defrisari culoar intre st 29-30 ;
30. /	Sn	2,6x2,6	-defrisari locale -40m ² ;sap. decop. caciuli-; - ref tenc sclivisite ; -p.p. BUNA;	40x40-h=60	-40.0 /500	2	-	3,9	-amplas in pad , la 100m drum care -defrisari culoar intre st 30-31 ;
31. /	Sn	3,0x3,0	-defrisari locale -50m ² ;sap. decop. caciuli-; - ref tenc sclivisite ; -p.p. RUGINITA;	50x50-h=50	-50.0 /500	4	-	3,9	-amplas in padure ; -defrisari culoar intre st 31-32 ;
32. /	Sn	2,6x2,6	-defrisari locale -50m ² ;sap. decop. caciuli-; - ref tenc sclivisite ; -p.p.RUGINITA;	2-40x40-h=50 2-40x40-h=20	-40.0 /500	3	-	3,6	-amplas in padure, panta mare -defrisari culoar intre st 32-33 ;

TABEL CU DEFECTELE CONSTATATE SI LUCRARILE DE REPARATII LA STALPII LEA 110 KV COZLA - SF. ELENA - MOLDOVA NOUĂ (Anexa 1.a)

Nr. crt. /nr.st	TIP STALP	DIST. INTRE PICIOARE (m)	DEFECTE CONSTATATE LUCRARI DE EXECUTAT	DIMENS. CACIULA LxIxH(cm)	FELUL LUCRARII DE REPARATII				OBS.
					Curatat acces stalp (m ²)	SAPAT (m ³)	BETON -B200 (m ³)	TENCUIELI SCLIVISITE (m ²)	
0	1	2	3	4	5	6	7	8	9
33. /	Sn	2,6x2,6	-defrisari locale -40m ² ;sap. decop. caciuli-; -caciuli sparte ; ref tenc sclivisite ; -p.p.RUGINITA;	40x40-h=60	-40.0 /400	2	-	4,0	-amplas in padure, teren in panta -defrisari culoar intre st 33-34 ; -traversare curs apa ; st. cu c. greutatea
34. (vechi 33)	Sn	2,6x2,6	-defrisari locale 30m ² ;-caciuli umpl.cu pam.+piatra - refac.tenc sclivisite;-p.p.RUGINITA ;	45x45-50	30	4		4,0	-amplas. in cultura porumb; -caciuli cu piatra si pam.
35. /	Sn	2,6x2,6	-defrisari locale 50m ² ;-caciuli umplute cu piatra si pamant;-refac.tenc sclivisite;-p.p.RUGINITA ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5	45x45-50	50	4		4,0	-amplas. colt prop.privata ; -caciuli cu piatra si pam.
36. /	Sn-	3,0x3,0	-Fundatie tip cheson ; sap de pamant ; -p.p. BUNA ;	-3,0x3,0		2			-amplas.linga riu , si drum de acces
37. /	Sn	3,0x3,0	-Fundatie tip cheson ; cosit-defrisat ; -p.p. BUNA ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5	-3,0x3,0	30	2			-amplas.linga drum de acces
38. /	Sn	2,6x2,6	-defrisari locale -50m ² ;sap. decop. 3caciuli-; - ref tenc sclivisite ; -p.p. BUNA ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5	50x50-h=40	-50.0 /500	3	-	3,5	-amplas in padure, panta mare -defrisari culoar intre st 38-37 ;
39. /	Sn	2,6x2,6	-defrisari locale -40m ² ;sap. decop. 1caciula-; - ref tenc sclivisite ; -p.p. BUNA ;	40x40-h=40	-40.0 /600	1	-	3,5	-amplas in padure, in virf de deal -defrisari culoar intre st 39-38 ;
40. /	Sn	2,6x2,6	-defrisari locale -40m ² ;sap. decop. caciuli-; - ref tenc sclivisite ; -p.p. BUNA ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5	40x40-h=40	-40.0 /500	2	-	3,5	-amplas in padure, panta mare -traversare curs apa ;
41. /	ITn110240	4,6x4,8	-defrisari locale -40m ² ;sap. indepartat apa ampls st.-; - ref tenc. sclivisite ; -p.p. BUNA ;	60x60-h=70	-40.0 /500	2	-	6,8	-amplas in varf de deal, linga casa cu antena ;-defrisare culoar catre st.42 ;
42. /	ITn110	4,1x4,1	-defrisat local 30m ² ;-sap.decop caciuli si apa amplas. -refac.tenc scliv.5mm din turnare	50x50-h=70	-30,0	4		5,6	-amplas.in finat, teren in panta
43. /	Sn	2,6x2,6	-defrisari locale -40m ² ;sap. decop. caciuli-; - ref tenc sclivisite ; -p.p. RUGINITA ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5	45x45-h=60	-40.0 / 400	4	-	4,8	-amplas in liziera, teren in panta -culoar defrisare st. 43-44 ;
44. /	Sn	2,6x2,6	-defrisari locale -40m ² ;sap. decop. caciuli-; -caciuli deteriorate; ref tenc sclivisite ; -p.p. BUNA ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5	40x40-h=60	-40.0 / 400	3	-	4,8	-amplas in finat, margine liziera, aproape de drum pt care ;

TABEL CU DEFECTELE CONSTATATE SI LUCRARILE DE REPARATII LA STALPII LEA 110 KV COZLA - SF. ELENA - MOLDOVA NOUĂ (Anexa 1.a)

Nr. crt. /nr.st	TIP STALP	DIST. INTRE PICIOARE (m)	DEFECTE CONSTATATE LUCRARI DE EXECUTAT	DIMENS. CACIULA LxIxH(cm)	FELUL LUCRARII DE REPARATII				OBS.
					Curatat acces stalp (m ²)	SAPAT (m ³)	BETON -B200 (m ³)	TENCUIELI SCLIVISITE (m ²)	
0	1	2	3	4	5	6	7	8	9
45. /	Sn	2,6x2,6	-defrisari locale -50m ² ;sap. decop. caciuli-; - ref tenc sclivisite din turnare; -p.p. RUGINITA ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5	40x55-h=70	-50.0 / 400	4	-	4,8	-amplas in finat, prop.particular, -culoar defrisare intre st. 45-46 ; -traversare curs apa
46. /	Sn	3,0x3,0	-defrisari locale -40m ² ;sap. decop. 3caciuli-; - ref tenc sclivisite ; -p.p. RUGINITA ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ; - baza st.ruginita-curtat de rugina si vopsit baza st.	45x45-h=70	-40.0 / 400	3	-	5,6	-amplas in liziera , in apropiere drum cariera piatra -culoar defrisare intre st. 46-47 ;
47. /	Sn	2,6x2,6	-defrisari locale -40m ² ;sap. indep. apa amplas st-; - ref tenc sclivisite ; -p.p. BUNA ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ; - baza st.ruginita-curtat de rugina si vopsit baza st.	45x45-h=60	-40.0 / 400	2	-	5,0	-amplas in liziera ; -culoar defrisare intre st. 47-48 ;
48. /	Sn	2,6x2,6	-defrisari locale -40m ² ;sap. sist.baza st.-; - ref tenc sclivisite ; -p.p. BUNA ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	40x40-h=70	-40.0 / 400	3	-	5,0	-amplas in margine liziera ; -culoar defrisare intre st. 48-49 ;
49. /	Sn	2,6x2,6	-defrisari locale -30m ² ;sap. decop.caciuli st-; - ref tenc sclivisite-buciardat-amorsa ; -p.p. BUNA ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	45x45-h=60	-30.0 / 400	2	-	5,0	-amplas in finat, linga livada ; -culoar defrisare intre st. 49-50 ;
50. /	Sn	2,6x2,6	-defrisari locale -30m ² ;sap. decop.caciuli st-; - ref tenc sclivisite-buciardat-amorsa ; -p.p. RUGINITA ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	45x45-h=60	-30.0 / 400	3	-	5,0	-amplas in finat, -culoar 10 copaci defrisati ;
51. /	Sn-	2,6x2,6	-defrisari locale -30m ² ;sap. decop. caciuli st-; - tencuieli sparte -ref tenc sclivisite ; -p.p. RUGINITA ; - baza st.ruginita-curtat de rugina si vopsit baza st.	40x40-h=70	-30.0 / 400	2	-	5,0	-amplas in finat la cca 10m de drum ; -culoar defrisare st.51-52;
52. /	Sn	2,6x2,6	-defrisari locale -30m ² ;sap. decop. caciuli st-; -ref tenc sclivisite ; -p.p. RUGINITA ; - baza st.ruginita-curtat de rugina si vopsit baza st.	40x40-h=50	-30.0	3	-	3,6	-amplas in finat ;
53. /	Sn	2,6x2,6	-defrisari locale -30m ² ;sap. decop. caciuli st-; - tencuieli sparte -ref tenc sclivisite ; -p.p. RUGINITA ; - baza st.ruginita-curtat de rugina si vopsit baza st.	50x50-h=50	-30.0 / 400	3	-	4,0	-amplas in poiana- padure ; -culoar defrisare st.53-54;
54. /	ITn110240	4,1x4,1	-defrisari locale -30m ² ;sap. decop. caciuli st-; -ref tenc sclivisite ; -p.p. BUNA ; - baza st.ruginita-curtat de rugina si vopsit baza st.	60x60-h=70	-30.0	2	-	6,8	-amplas in finat in varf de deal ; -acces de la DN-Yacht Club-Liubcov

TABEL CU DEFECTELE CONSTATATE SI LUCRARILE DE REPARATII LA STALPII LEA 110 kV COZLA - SF. ELENA - MOLDOVA NOUĂ (Anexa 1.a)

Nr. crt. /nr.st	TIP STALP	DIST. INTRE PICIOARE (m)	DEFECTE CONSTATATE LUCRARI DE EXECUTAT	DIMENS. CACIULA LxIxH(cm)	FELUL LUCRARII DE REPARATII				OBS.
					Curatat acces stalp (m ²)	SAPAT (m ³)	BETON -B200 (m ³)	TENCUIELI SCLIVISITE (m ²)	
0	1	2	3	4	5	6	7	8	9
55. /	Sn	2,6x2,6	-defrisari locale -30m ² ;sap. decop. caciuli st-; -ref tenc sclivisite ; -p.p. BUNA ;	45x45-h=70	-30.0 -700	2	-	5,6	-amplas in finat, teren in panta ; - culoar de defrisat intre st .55-54
56. /	Sn	2,6x2,6	-defrisat-cosit -30m ² ; sap. decop. 2caciuli st-; -ref tenc sclivisite ; -p.p. BUNA ; - baza st.ruginita-curtat de rugina si vopsit baza st.	2-40x40-h=70 2-40x40-h=50	-30.0	3	-	4,0	-amplas in poiana ;
57. /	Sn	2,6x2,6	-defrisari locale -60m ² ;sap. decop.caciuli st-; - ref tenc sclivisite-buciardat-amorsa ; -p.p. BUNA; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	40x40-h=50	-60.0 / 400	2	-	5,0	-amplas in finat, linga drum pt care; -culoar catre st.58 (cca 20pomi) ;
58. /	Sn	2,6x2,6	-defrisari locale -30m ² ;sap. decop.caciuli st-; - ref beton si tenc scliv-buciardat-amorsa ; -p.p. BUNA; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ; - baza st.ruginita-curtat de rugina si vopsit baza st.	40x40-h=50	-30.0 / 400	3	1	3,6	-amplas in finat, linga drum pt care;
59. /	Sn	2,6x2,6	-defrisari locale -30m ² ;sap. decop. caciuli st-; -ref tenc sclivisite ; -p.p. BUNA ;	40x40-h=70	-30.0	2	-	5,0	-amplas in finat,;
60. /	Sn	2,6x2,6	-defrisari locale -50m ² ;sap. decop. caciuli st-; -ref tenc sclivisite ; -p.p. RUGINITA ;	40x40-h=60	-50.0	3	-	5,0	-amplas in finat, , linga un cires si drum pt care ;
61. /	Sn	2,6x2,6	-defrisari locale -30m ² ;sap. decop.caciuli st-; - ref. tenc scliv-buciardat-amorsa ; -p.p. BUNA; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	40x40-h=60	-30.0	2	-	5,0	-amplas in finat, la 100m de drum pt care;
62. /	Sn	2,6x2,6	-defrisari locale -30m ² ;sap. decop.caciuli st-; - ref. tenc scliv-buciardat-amorsa ; -p.p. RUGINITA; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	50x50-h=50	-30.0	2	-	4,0	-amplas in finat, linga cultura porumb si drum pt care;
63. /	Sn	2,6x2,6	-defrisari locale -30m ² ; - ref .tenc scliv-buciardat-amorsa ; -p.p. BUNA; - baza st.ruginita-curtat de rugina si vopsit baza st.	50x50-h=60	-30.0	2	-	5,0	-amplas in deal, linga drum pt care;
64. /	Sn	2,6x2,6	-defrisari locale -30m ² ;sap. decop.caciuli st-; - ref. tenc scliv-buciardat-amorsa ; -p.p. BUNA; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	45x45-h=60	-30.0	-	-	5,0	-amplas dupa piriu, linga porumb; -marcat cu nr. 63 !!!! ;
65. /	Sn	2,6x2,6	-defrisari locale -40m ² ;sap. decop.caciuli st-; - ref. tenc scliv-buciardat-amorsa ; -p.p. BUNA;	60x60-h=70	-40.0 -200.0	2	-	5,0	-amplas linga gosp.partic. si drum pt care ; -defrisat cca 200mp ;
66. /	Sn	2,6x2,6	-defrisari lastaris-40m ² ;sap. decop.caciuli st-; - ref. tenc scliv-buciardat-amorsa ; -p.p. RUGINITA; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	45x45-h=60	-40.0	2	-	5,0	-amplas linga cultura de porumb ;

TABEL CU DEFECTELE CONSTATATE SI LUCRARILE DE REPARATII LA STALPII LEA 110 kV COZLA - SF. ELENA - MOLDOVA NOUĂ (Anexa 1.a.)

Nr. crt. /nr.st	TIP STALP	DIST. INTRE PICIOARE (m)	DEFECTE CONSTATATE LUCRARI DE EXECUTAT	DIMENS. CACIULA LxlxH(cm)	FELUL LUCRARII DE REPARATII				OBS.
					Curatat acces stalp (m ²)	SAPAT (m ³)	BETON -B200 (m ³)	TENCUIELI SCLIVISITE (m ²)	
0	1	2	3	4	5	6	7	8	9
67. /	Sn	2,6x2,6	-defrisari local-30m ² ;sap. decop. 2caciuli st-; - ref. tenc scliv-buciardat-amorsa ; -p.p. RUGINITA; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	40x40-h=70	-30.0	2	-	5,0	-amplas in margine padure, aproape de drum pt care ;
68. /	Sn	2,6x2,6	-defrisari local-40m ² ;sap. decop. 2caciuli st-; - ref. tenc sclivisite ; -p.p. RUPTE !!!! -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ; - baza st.ruginita-curtat de rugina si vopsit baza st.	45x45-h=70	-40.0 -400.0	2	-	5,6	-amplas in margine padure, ; -culoar de defrisat cca 400mp
69. /	Sn	2,6x2,6	-defrisari lastaris-60m ² ;sap. decop. 2caciuli st-; -tencuieli sparte- ref. tenc sclivisite ; -p.p. RUPTE !!!! -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	40x40-h=70	-60.0	2	-	5,0	-amplas in lastaris la cca 100m drum pt care ;
70. /	Sn	2,6x2,6	-defrisari-cosit-30m ² ;sap. decop. 2caciuli st-; -tencuieli sparte- ref. tenc sclivisite ; -p.p. RUPTE !!!! -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	40x40-h= 60	-30.0	2	-	5,0	-amplas pe deal , in finat ;
71. /	Sn	2,6x2,6	-defrisari lastaris-40m ² ;sap. decop. caciuli st-; -tencuieli sparte- ref. tenc sclivisite ; -p.p. RUGINITA -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	40x40-h=50	-40.0	2	-	4,0	-amplas in finat , linga drum pt care ;
72. /	Sn	2,6x2,6	-defrisari -30m ² ;sap. decop. 2caciuli st-; -tencuieli sparte- ref. tenc sclivisite ; -p.p. RUGINITA si <u>DESFACUTA !!!!</u> -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	45x45-h= 60	-30.0	3	-	5,0	-amplas in finat la cca 150m drum pt care ;
73. /	Sn	2,6x2,6	-defrisari -30m ² ; caciuli ingropate !!!! -; -tencuieli sparte- ref. tenc sclivisite ; -p.p. RUGINITA! -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	45x45-h= 70	-30.0 -600.0	4	-	5,6	-amplas teren in panta ; -culoar cca 600 mp catre st.72
74. /	Sn	2,6x2,6	-defrisari local -30m ² ; - ref. tenc sclivisite total ; -p.p. RUPTA !!!! -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	45x45-h= 50	-30.0 -200.0	-	-	4,0	-amplas in finat in virf de deal ; -culoar catre st 73 cca 200mp
75. /	Sn	2,6x2,6	-defrisari -30m ² ;sap. decop. caciuli st-; -tencuieli sparte- ref. tenc sclivisite ; -p.p. RUPTE !! -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	45x45-h= 60	-30.0	3	-	5,6	-amplas in poiana-finat la marginea padurii ;
76. /	Sn	2,6x2,6	-defrisari – cosit 50m ² ; - ref. tenc sclivisite ; -p.p. RUGINITA! -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	45x45-h= 60	-50.0 -800.0	4	-	5,6	-amplas teren in liziera ; -culoar cca 800 mp catre st.75

TABEL CU DEFECTELE CONSTATATE SI LUCRARILE DE REPARATII LA STALPII LEA 110 kV COZLA - SF. ELENA - MOLDOVA NOUĂ (Anexa 1.a.)

Nr. crt. /nr.st	TIP STALP	DIST. INTRE PICIOARE (m)	DEFECTE CONSTATATE LUCRARI DE EXECUTAT	DIMENS. CACIULA LxIxH(cm)	FELUL LUCRARII DE REPARATII				OBS.
					Curatat acces stalp (m ²)	SAPAT (m ³)	BETON -B200 (m ³)	TENCUIELI SCLIVISITE (m ²)	
0	1	2	3	4	5	6	7	8	9
77. /	Ss	2,6x2,6	-defrisari -30m ² ;sap. decop. 2caciuli st-; - ref. tenc sclivisite ; -p.p. <u>RUGINITA!</u> -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	45x45-h= 60	-30.0	2	-	5,6	-amplas in finat, linga un cires, la 70m de drum pt care ;
78. /	Ss	2,6x2,6	-defrisari – cosit 30m ² ; - sap. decop. caciuli st-; - ref. tenc sclivisite ; -p.p. <u>RUGINITA!</u> -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	40x40-h= 70	-30.0	2	-	5,0	-amplas in finat ; -
79. /	Sn-	2,6x2,6	-defrisari 30m ² ; - sap. decop. 2caciuli st-; -tencuieli sparte- ref. tenc sclivisite ; -p.p. <u>RUGINITA!</u> -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	40x40-h= 60	-30.0 -200.0	2	-	5,0	-amplas in teren in panta ; -culoar catre st. 78 cca 200mp
80. /	Sn	2,6x2,6	-defrisari 30m ² ; - sap. decop. 2caciuli st-; - ref. tenc sclivisite ; -p.p. <u>BUNA</u> -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	45x45-h= 60	-30.0	2	-	5,6	-amplas in finat pe deal, la cca 70m de drum pt care ;
81. /	Sn	2,6x2,6	-defrisari local-30m ² ; - sap. decop. caciuli st-; - ref. tenc sclivisite ; -p.p. <u>BUNA</u> -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	40x40-h= 70	-30.0	2	-	5,0	-amplas in finat ;
82. /	ITn110240	4,1x4,1	-defrisari – cosit 30m ² ; - sap. decop. caciuli st-; - ref. tenc sclivisite ; -p.p. <u>BUNA</u> -lipsa 2buc-c.vant.- inloc. cu sudura L50x50x5-3m	50x60-h= 80	-30.0	2	-	6,5	-amplas in virf de deal , la cca 100m de drum pt care
83. /	Sn	2,6x2,6	-defrisari – cosit 30m ² ; - sap. decop. caciuli st-; -3caciuli sparte- ref. tenc sclivisite ; -p.p. <u>RUGINITA-</u> -1surub lipsa;-c.vant-X-lipsa-inloc.L50x50x5-sudat;	40x40-h= 80	-30.0	3	-	5,2	-amplas teren in panta , la cca 50m de drum pt care
84. /	Sn	2,6x2,6	-defrisari-cosit local-30m ² ; -caciuli sparte- ref. tenc sclivisite ; -p.p. <u>BUNA</u> -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	40x40-h= 50	-30.0	-	-	4,0	-amplas in finat la cca 70m de drum pt care
85. /	Sn	2,6x2,6	-defrisari local-20m ² ; - sap. decop. caciuli st-; -2caciuli sparte- ref. tenc sclivisite ; -p.p. <u>BUNA</u> -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ; -lipsa 2suruburi M20 la imbinare montanti ;	40x40-h= 60	-20.0	2	-	5,0	-amplas in cultura de porumb , exista drum pt care la 50m ;
86. /	Sn	2,6x2,6	-defrisari local-30m ² ; - sap. decop. caciuli st-; -caciuli crapate -ref. tenc sclivisite ; -p.p. <u>BUNA</u> -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ; - baza st.ruginita-curtat de rugina si vopsit baza st.	40x40-h= 60	-30.0	2	-	5,0	-amplas in vitf de deal, linga drum de care ;

TABEL CU DEFECTELE CONSTATATE SI LUCRARILE DE REPARATII LA STALPII LEA 110 kV COZLA - SF. ELENA - MOLDOVA NOUĂ (Anexa 1.a.)

Nr. crt. /nr.st	TIP STALP	DIST. INTRE PICIOARE (m)	DEFECTE CONSTATATE LUCRARI DE EXECUTAT	DIMENS. CACIULA LxIxH(cm)	FELUL LUCRARII DE REPARATII				OBS.
					Curatat acces stalp (m ²)	SAPAT (m ³)	BETON -B200 (m ³)	TENCUIELI SCLIVISITE (m ²)	
0	1	2	3	4	5	6	7	8	9
87. /	Sn	2,6x2,6	-defrisari local-20m ² ; - sap. decop. caciuli st-; -tenc. crapate - ref. tenc sclivisite ; - <u>p.p.RUGINITA,surub lipsa si la fixare montanti M20,M24</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	40x40-h= 50	-20.0	2	-	4,0	-amplas in finat , exista drum pt care la 100m ;
88. /	Sn	2,6x2,6	-defrisari local-30m ² ; -caciuli crapate -ref. tenc sclivisite ; - <u>p.p. BUNA</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	40x40-h= 50	-30.0	-	-	4,0	-amplas in finat ;
89. /	Sn	2,6x2,6	-defrisari local-30m ² ; -tenc. crapate - ref. tenc sclivisite ; - <u>p.p.RUGINITA,surub rugini</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	50x50-h= 50	-30.0	-	-	4,0	-amplas in finat , linga LEA 20kV
90. /	Sn	2,6x2,6	-tenc. crapate - ref. tenc sclivisite ; - <u>p.p.BUNA</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	50x50-h= 40	-20.0	-	-	4,0	-amplas in teren plan-finata, in spate la dispensar ;
91. /	Sn	2,6x2,6	-defrisari local-50m ² ; - sap. decop. caciuli st-; -tenc. crapate - ref. tenc sclivisite ; - <u>p.p.BUNA</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	60x60-h= 100	-50.0 -200.0	2	-	9,6	-amplas in curte prop.privata ; linga drum de acces ;
92. /	Sn	2,6x2,6	-defrisari local-20m ² ; -tenc. crapate - ref. tenc sclivisite ; - <u>p.p.BUNA</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	40x40-h= 60	-20.0	2	-	5,0	-amplas in gradina prop.privata ; -culoar cca200mp catre st.90
93. /	Sn	2,6x2,6	-defrisari-cosit local-40m ² ; - sap. decop. 3 caciuli st-; -tenc. crapate - ref. tenc sclivisite ; - <u>p.p.BUNA</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	40x40-h= 60	-40.0	2	-	5,0	-amplas in pasune ;
94. /	Sn	2,6x2,6	-defrisari-cosit- 30m ² ; - sap. decop. 2 caciuli st-; -tenc. crapate - ref. tenc sclivisite ; - <u>p.p.BUNA</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ; - baza st.ruginita-curtat de rugina si vopsit baza st.	40x40-h= 60	-30.0	2	-	5,0	-amplas in pasune ;
95. /	Sn	2,6x2,6	-defrisari-cosit- 40m ² ; - sap. decop. 2 caciuli st-; -tenc. crapate - ref. tenc sclivisite ; - <u>p.p.BUNA</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	50x50-h= 60	-40.0	2	-	5,0	-amplas la cca 20m de drum pt care;
96. /	Sn	2,6x2,6	-defrisari- 40m ² ; - sap. decop. caciuli st-; -tenc. crapate - ref. tenc sclivisite ; - <u>p.p.BUNA</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	2-50x50-h=70 2-50x50-h=40	-40.0	2	-	4,8	-amplas in pasune la cca 120m de drum pt care ;

TABEL CU DEFECTELE CONSTATATE SI LUCRARILE DE REPARATII LA STALPII LEA 110 KV COZLA - SF. ELENA - MOLDOVA NOUĂ (Anexa 1.a)

Nr. crt. /nr.st	TIP STALP	DIST. INTRE PICIOARE (m)	DEFECTE CONSTATATE LUCRARI DE EXECUTAT	DIMENS. CACIULA LxIxH(cm)	FELUL LUCRARII DE REPARATII				OBS.
					Curatat acces stalp (m ²)	SAPAT (m ³)	BETON -B200 (m ³)	TENCUIELI SCLIVISITE (m ²)	
0	1	2	3	4	5	6	7	8	9
97. /	Sn	2,6x2,6	-defrisari-cosit-30m ² ; -tenc. crapate - ref. tenc sclivisite ; - <u>p.p.RUGINITA- 1surub lipsa</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	50x50-h=70	-30.0	-	-	5,6	-amplas in finat la cca 100m de drum pt care ;
98. /	Sn	2,6x2,6	-defrisari- 40m ² ; - sap. decop. 3caciuli st-; -tenc. crapate - ref. tenc sclivisite ; - <u>p.p.BUNA</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	-50x50-h=60	-40.0 -500.0	3	-	5,0	-amplas in padure linga drum pt care – culoar catre st.97
99. /	ITn110291	5,7x4,0	-defrisari- 70m ² ; - sap. decop. caciuli st-; - beton+ref. tenc sclivisite; - <u>p.p.RUGINITA si desfacuta</u> ; -3buc c.vantuire-lipsa- inloc. sudat L50x50x5;-12m	-60x60-h=50	-70,0 -600,0	4	-	5,0	-amplas in varf de deal,acces greu; -culoar catre st.98 -600 mp ;
100. /	ITn110231	5,0x3,6	-defrisari- 40m ² ; - sap. decop. 2caciuli st-; -tenc. deteriorate - ref. tenc sclivisite ; - <u>p.p.RUGINITA</u>	-60x60-h=70	-40.0 -400.0	2	1	6,8	-amplas in deal- finat –culoar catre st.99
101. /	Sn	2,6x2,6	-defrisari-cosit- 30m ² ; -fundatii deteriorate-buciardat - beton+ref. tenc sclivisite ; - <u>p.pRUGINITA</u> -	-40x40-h=60	-30.0	-	1	5,0	-amplas in gospodarie privata ;
102. /	Sn	2,6x2,6	-defrisari- 40m ² ; - sap. decop. 2caciuli st-; -2caciuli sparte- ref. tenc sclivisite ; - <u>p.p.BUNA</u> ;	-50x50-h=50	-40.0 -600,0	2	-	4,0	-amplas in padure –culoar catre st. 101
103. /	Sn	2,6x2,6	-defrisari- 30m ² ; - sap. decop. 2caciuli st-; -3caciuli sparte- ref. tenc sclivisite ; - <u>p.pRUGINITA</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	-45x45-h= 70	-30.0 -400,0	2	-	5,6	-amplas in liziera –culoar catre st. 102
104. /	Sn	2,6x2,6	-cosit-defrisari- 30m ² ; - sap. decop. caciuli st-; -tenc. crapate - ref. tenc sclivisite ; - <u>p.p.BUNA</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	-45x45-h=60	-30.0	2	-	5,0	-amplas linga padure si drum pt care
105. /	Ss	3,0x3,0	-defrisari locale- 30m ² ; - sap. decop. caciuli st-; -tenc. crapate - ref. tenc sclivisite ; - <u>p.pRUGINITA</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	-45x45-h=50	-30.0 -500.0	2	-	5,0	-amplas in finat linga drum pt care – culoar catre st. 104
106. /	Sn	2,6x2,6	-defrisari -cosit- 30m ² ; - sap. decop. caciuli st-; -tenc. crapate - ref. tenc sclivisite ; - <u>p.pRUGINITA</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	-40x40-h= 50	-30.0	2	-	4,0	-amplas in finat
107. /	ICn110263	5,0x3,6	-defrisari- 40m ² ; - sap. decop. 2caciuli st-; -tenc. deteriorate - ref. tenc sclivisite ; p.p.in fund st. -8buc c.vantuire-lipsa- inloc. sudat L50x50x5;-16m	-60x60-h=70	-40.0 -500.0 -600.0	2	-	6,8	-amplas in finat, teren in panta –culoar catre st. 106 ; 108
108. /	ICn110263	5,0x3,6	-defrisari- 30m ² ; - sap. sist. baza st-; -tenc. deteriorate - ref. tenc sclivisite ; p.p.in fund st.	-60x55-h=70	-30.0	3	-	6,8	-amplas in cultura de porumb; –exista drum de care in zona

TABEL CU DEFECTELE CONSTATATE SI LUCRARILE DE REPARATII LA STALPII LEA 110 KV COZLA - SF. ELENA - MOLDOVA NOUĂ (Anexa 1.a)

Nr. crt. /nr.st	TIP STALP	DIST. INTRE PICIOARE (m)	DEFECTE CONSTATATE LUCRARI DE EXECUTAT	DIMENS. CACIULA LxIxH(cm)	FELUL LUCRARII DE REPARATII				OBS.
					Curatat acces stalp (m ²)	SAPAT (m ³)	BETON -B200 (m ³)	TENCUIELI SCLIVISITE (m ²)	
0	1	2	3	4	5	6	7	8	9
109. /	ICn+6 110240	6,2x4,4	-defrisari- 40m ² ; - sap. decop.caciuli st+rigole apa;- -tenc. deteriorate - ref. tenc sclivisite ; p.p.in fund st.	-50x50-h=80	-40.0 -300.0	3+6	-	6,8	-amplas in virf de deal, acces greu -culoar catre st. 110-25copaci
110. /	ICn+3 110240	5,4x4,4	-defrisari- 40m ² ; - sap. decop.caciuli st. ; -tenc. deteriorate - ref. tenc sclivisite ; p.p.in fund st.	-50x50-h=70	-40.0	4	-	6,8	-amplas in virf de deal, acces greu -exista drum de care in zona
111. /	Sn	2,6x2,6	-defrisari - 50m ² ; - sap. decop. caciuli st-; - ref. tenc sclivisite ; - <u>p.p BUNA</u> ; - baza st.ruginita-curtat de rugina si vopsit baza st.	-40x40-h= 60	-30.0 -200.0	2	-	4,0	-amplas in varf de deal -exista drum de care in zona -culoar catre st. 112 -25copaci
112. /	Sn	2,6x2,6	-defrisari -cosit- 30m ² ; - sap. decop. caciuli st-; -tenc. crapate - ref. tenc sclivisite ; - <u>p.p BUNA</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	-60x60-h= 60	-30. -500.0	2	-	5,8	-amplas in padure , langa drum care -culoar catre st. 113
113. /	Sn	2,6x2,6	-defrisari - 50m ² ; - sap. decop. caciuli st-; - ref. tenc sclivisite ; - <u>p.p BUNA</u> ;	-40x40-h= 50	-50.0 -600.0	2	-	4,0	-acces dificil, lastaris ;exista drum care in zona - culoar catre st. 114 -
114. /	Sn	2,6x2,6	-defrisari -30m ² ; - sap. decop. caciuli st-; -tenc. crapate - ref. tenc sclivisite ; - <u>p.p RUGINITA</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ; - baza st.ruginita-curtat de rugina si vopsit baza st.	-45x45-h= 60	-30. -500.0	2	-	5,0	-amplas in varf de deal , langa poteca -culoar catre st. 115 -
115. /	Sn	2,6x2,6	-defrisari - 30m ² ; - sap. decop. caciuli st-; - 4caciuli sparte -ref. tenc sclivisite ; - <u>p.p RUGINITA</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	-40x40-h= 50	-30. -300.0	2	-	4,0	-amplas in poiana la cca 100m drum care -linga pom scobit de ciocanit; -culoar catre st. 116
116. /	Sn	2,6x2,6	-defrisari - 30m ² ; - sap. decop. caciuli st-; -tenc. crapate - ref. tenc sclivisite ; - <u>p.p RUGINITA</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	-40x40-h= 70	-30. -200.0	2	-	5,6	-amplas in poiana , langa drum care -culoar catre st. 117
117. /	Sn	2,6x2,6	-defrisari - 30m ² ; - sap. decop. caciuli st-; -tenc. crapate - ref. tenc sclivisite ; - <u>p.p RUGINITA</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	-40x40-h= 60	-30. -900.0	2	-	5,6	-amplas in poiana, drum care la150m -culoar catre st. 119
118. /	Sn	2,6x2,6	-defrisari - 30m ² ; - sap. decop. 2caciuli st-; -tenc. crapate - ref. tenc sclivisite ; - <u>p.p RUGINITA</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	2-50x50-h= 50 2-60x60-h=60	-30. -800.0	2	-	5,6	-teren accidentat; drum care la180m -culoar catre st. 120
119. /	Sn	2,6x2,6	-defrisari -100m ² ; - sap. decop. caciuli st-; -tenc. crapate - ref. tenc sclivisite ; - <u>p.p RUGINITA</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	-40x40-h= 60	-100. -900.0	2	-	5,0	-amplas in poiana , langa drum care -culoar catre st. 121

TABEL CU DEFECTELE CONSTATATE SI LUCRARILE DE REPARATII LA STALPII LEA 110 KV COZLA - SF. ELENA - MOLDOVA NOUĂ (Anexa 1.a.)

Nr. crt. /nr.st	TIP STALP	DIST. INTRE PICIOARE (m)	DEFECTE CONSTATATE LUCRARI DE EXECUTAT	DIMENS. CACIULA LxlxH(cm)	FELUL LUCRARII DE REPARATII				OBS.
					Curatat acces stalp (m ²)	SAPAT (m ³)	BETON -B200 (m ³)	TENCUIELI SCLIVISITE (m ²)	
0	1	2	3	4	5	6	7	8	9
120. /	Sn	3,6x3,6	-defrisari -100m ² ; - sap. decop. caciuli st-; -tenc. crapate - ref. tenc sclivisite ; - <u>p.p RUGINITA</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ; - baza st.ruginita-curtat de rugina si vopsit baza st.	-50x50-h= 60	-100. -800.0	2	-	5,2	-teren in panta mare , drum care -culoar catre st. 122
121. /	ICn110131	4,5x4,5	-defrisari locale-40m ² ; - sap. decop. caciuli st-; -tenc. deteriorate - ref. tenc sclivisite ; p.p.in fund st.	-60x60-h= 80	-40.0	3	-	7,8	-amplas in finat, -traverseaza apa -exista drum in zona
122. /	ICn+6 110240	6,5x4,5	-defrisari- 30m ² ; - sap. decop.caciuli st+rigole apa-; -tenc. deteriorate - ref. tenc sclivisite ; p.p.in fund st. - baza st.ruginita-curtat de rugina si vopsit baza st.	-60x60-h=80	-30.0	2	-	7,8	-amplas linga gradina de legume
123. /	Sn	2,6x2,6	-defrisari -30m ² ; - sap. decop. caciuli st-; -tenc. crapate - ref. tenc sclivisite ; - <u>p.p BUNA</u> ; -c.vant.-X-fixat prin sudur-Vopsit baza st.;	-40x40-h= 50	-30.	2	-	5,0	-amplas in gradina particular
124. /	Sn	2,6x2,6	-defrisari -30m ² ; - sap. decop. caciuli st-; -3caciuli det. - ref. tenc sclivisite ; - <u>p.p BUNA</u> ; -c.vantuire-X-fixare prin sudura ;	-40x40-h= 70	-30. -500	2	-	5,0	-amplas in teren plan, -culoar de defrisare catre st. 123
125. /	Sn	2,6x2,6	-defrisat-cosit- 30m ² ; -2caciuli deteriorate ; - ref. tenc sclivisite ; - <u>p.p RUGINITA</u> ;	-50x50-h= 60	-30.	-	-	5,0	-amplas in pasune ;
126. /	Sn	2,6x2,6	-defrisari-cosit-30m ² ; - ref. tenc sclivisite ; - <u>p.p BUNA</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5	-50x50-h= 70	-30.	-	-	5,6	-amplas in teren in panta, linga drum care
127. /	Sn	2,6x2,6	-defrisari -30m ² ; - sap. decop. caciuli st-; - ref. tenc sclivisite ; - <u>p.p BUNA</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5	-50x50-h= 70	-30. -500.0	3	-	5,6	-acces greu ; -culoar catre st. 128
128. /	Sn	2,6x2,6	-defrisari -30m ² ; - ref. tenc sclivisite ; - <u>p.p BUNA</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	-50x50-h= 70	-30. -500.0	-	-	5,6	-acces linga drum de care ; -culoar catre st. 129
129. /	Sn	2,6x2,6	-defrisari -30m ² ; - ref. tenc sclivisite ; - <u>p.p RUGINITA</u> ; - baza st.ruginita-curtat de rugina si vopsit baza st.	-40x40-h= 60	-30. -900.0	-	-	4,0	-teren in panta, acces greu ;drum care -culoar catre st. 130-lipsa gabarit
130. /	Sn+3	3,0x3,0	-defrisari -30m ² ; - sap. decop. caciuli st-; - ref. tenc sclivisite ; - <u>p.p RUGINITA-2 surub lipsa</u> ; - baza st.ruginita-curtat de rugina si vopsit baza st.	-40x40-h= 60	-30.	3	-	4,0	-teren in panta, acces greu ;
131. /	ITn110240	4,1x4,1	-defrisari -30m ² ; -caciuli det.armat ruginita - ref. tenc sclivisite ; - <u>p.p RUGINITA</u> ; - baza st.ruginita-curtat de rugina si vopsit baza st.	-65x65-h= 70	-30.	-	-	8,0	- amplas in virf de deal, la cca 100 drum pt care

TABEL CU DEFECTELE CONSTATATE SI LUCRARILE DE REPARATII LA STALPII LEA 110 KV COZLA - SF. ELENA - MOLDOVA NOUĂ (Anexa 1.a.)

Nr. crt. /nr.st	TIP STALP	DIST. INTRE PICIOARE (m)	DEFECTE CONSTATATE LUCRARI DE EXECUTAT	DIMENS. CACIULA LxIxH(cm)	FELUL LUCRARII DE REPARATII				OBS.
					Curatat acces stalp (m ²)	SAPAT (m ³)	BETON -B200 (m ³)	TENCUIELI SCLIVISITE (m ²)	
0	1	2	3	4	5	6	7	8	9
132. /	Sn	2,6x2,6	-defrisat-cosit- 20m ² ; - sap. decop. caciuli st-; - ref. tenc sclivisite ; - <u>p.p RUGINITA</u> ; -c.vantuire-X-fixare prin sudura ;	-50x50-h= 60	-20.	2	-	5,0	-amplas linga drum turbine eoliene ;
133. /	Sn	2,6x2,6	-defrisari -30m ² ; - sap. decop. caciuli st-; - ref. tenc sclivisite ; - <u>p.p RUGINITA</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 - baza st.ruginita-curtat de rugina si vopsit baza st.	-60x60-h= 100 -50x50-h=40	-30.	2	-	6,4	-teren in panta, acces greu ; poteca
134. /	Sn	2,6x2,6	-defrisari -20m ² ; - sap. decop. caciuli st-; - ref. tenc sclivisite ; - <u>p.p BUNA</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 ;	-60x60-h= 70 -50x50-h= 50	-20.	2	-	5,0	-teren in panta, acces greu ;
135. /	Sn	2,6x2,6	-defrisari -cosit-30m ² ; buciardat - ref. tenc sclivisite ; - <u>p.p BUNA</u> ; -c.vant-X-lipsa- inloc.cu sud.L50x50x5	-40x40-h= 70	-30.	-	-	5,0	-teren in panta, acces greu ;
136. /	Sn+3	3,0x3,0	-defrisari -30m ² ; -buciardat - ref. tenc sclivisite ; - <u>p.p BUNA</u> -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 - baza st.ruginita-curtat de rugina si vopsit baza st.	-60x60-h= 70 -40x40-h= 60	-30.	2	-	5,4	-teren in panta, acces greu ;
137. /	Sn	2,6x2,6	-defrisari -20m ² ; -caciuli sparte -buciardat - ref. tenc sclivisite ; - <u>p.p BUNA</u> -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5	-40x40-h= 60	-20.	2	0,3	4,0	-teren in panta, la cca 100m drum pt care ;
138. /	Sn	2,6x2,6	-defrisari -20m ² ; sap. decop. caciuli st-; -buciardat - ref. tenc sclivisite ; - <u>p.p BUNA</u> -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5	-40x40-h= 50	-20.	2	-	4,0	- amplasat linga drum pt care ;
139. /	Sn	2,6x2,6	-defrisari -30m ² ; sap. decop. caciuli st-; -buciardat - ref. tenc sclivisite ; - <u>p.p BUNA</u> -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5	-40x40-h= 70	-30.	2	-	5,0	- amplasat linga drum pt care ;
140. /	Sn	2,6x2,6	-defrisari - 30m ² ; sap. decop. caciuli st-; -buciardat - ref. tenc sclivisite ; - <u>p.p BUNA</u> -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5	-40x40-h= 50	-30.	2	-	4,0	- amplasat la cca 100m drum pt care; -langa cires
141. /	Sn	2,6x2,6	-defrisari -20m ² ; sap. decop. caciuli st-; - ref. tenc sclivisite ; - <u>p.p RUGINITA</u> -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 - baza st.ruginita-curtat de rugina si vopsit baza st.	-40x40-h= 50	-20.	2	-	4,0	- amplasat la 10m de drum pt care ;

TABEL CU DEFECTELE CONSTATATE SI LUCRARILE DE REPARATII LA STALPII LEA 110 KV COZLA - SF. ELENA - MOLDOVA NOUĂ (Anexa 1.a)

Nr. crt. /nr.st	TIP STALP	DIST. INTRE PICIOARE (m)	DEFECTE CONSTATATE LUCRARI DE EXECUTAT	DIMENS. CACIULA LxIxH(cm)	FELUL LUCRARII DE REPARATII				OBS.
					Curatat acces stalp (m ²)	SAPAT (m ³)	BETON -B200 (m ³)	TENCUIELI SCLIVISITE (m ²)	
0	1	2	3	4	5	6	7	8	9
142. /	Sn	2,6x2,6	-defrisari -30m ² ; sap. decop. caciuli st; -buciardat - ref. tenc sclivisite ; - <u>p.p BUNA</u> -c.vantuire-X-lipsa- inloc. sudura L50x50x5+2m c.v.	-60x60-h= 70	-30.	3	-	6,8	-teren in panta , linga drum pt care ;
143. /	Sn	2,6x2,6	-defrisari -40m ² ; sap. decop. caciuli st; -buciardat - ref. tenc sclivisite ; - <u>p.p BUNA</u> -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5	-60x60-h= 90	-40. -500.0	3	-	8,7	- teren in panta , linga drum pt care ; -culoar catre st . 145
144. /	Sn	2,6x2,6	-defrisari -30m ² ; sap. decop. caciuli st + rigole apa ; -buciardat - ref. tenc sclivisite ; - <u>p.p. RUGINITA</u> -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5	-50x50-h= 50	-30.	3	-	5,0	-consolidat montant indoit -amplas. linga drum eoliene ; -culoar catre st. 145
145. /	Sn	2,6x2,6	-defrisari locale-20m ² ; sap. sist. baza st. ; -buciardat - ref. tenc sclivisite ; - <u>p.p BUNA</u> - baza st.ruginita-curtat de rugina si vopsit baza st.	-50x50-h= 60	-20. -400	2	-	5,0	- amplasat linga drum care - culoar catre st. 146
146. /	Sn	2,6x2,6	- sap. decop. caciuli st + rigole apa ; -buciardat - ref. tenc sclivisite ; - <u>p.p. RUGINITA</u> -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5	-50x50-h= 50	-20. -400	2	-	5,0	-amplas. linga drum eoliene ; -culoar catre st. 146
147. /	Sn	2,6x2,6	-defrisari -30m ² ; sap. decop. caciuli st + rigole apa ; -buciardat - ref. tenc sclivisite ; - <u>p.p. RUGINITA</u> -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5	-50x50-h= 60	-30.	3	-	5,0	-amplas. linga drum pt care ;
148. /	ITn110240	4,1x4,1	-defrisari locale-30m ² ; sap. decop. caciuli st ; -buciardat - ref. tenc sclivisite ; - <u>p.p.in fundatie st.</u>	-60x60-h= 70	-30.	3	-	6,8	-amplas. teren inclinat ;
149. /	Sn	2,6x2,6	-defrisari -20m ² ; sap. decop. caciuli st ; -buciardat - ref. tenc sclivisite ; - <u>p.p. RUGINITA</u> -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5	-50x50-h= 50	-20.	2	-	5,0	-amplas. la 20m de drum pt eoliene
150. /	Sn	2,6x2,6	-defrisari -30m ² ; sap. decop. caciuli st ; - ref. tenc sclivisite ; - <u>p.p. RUGINITA</u> -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5	-50x50-h= 60	-30.	2	-	5,0	-amplas. la 10m de drum pt eoliene ;
151. /	Sn	2,6x2,6	-defrisari -20m ² ; sap. decop. caciuli st ; - ref. tenc sclivisite ; - <u>p.p. RUGINITA</u> -c.vantuire baza- lovita cu buldozerul-de indreptat	-60x60-h= 50	-20.	2	-	5,0	-amplas. la 3m de drum pt eoliene ;
152. /	Sn	2,6x2,6	-defrisari -30m ² ; sap. decop. caciuli st ; - ref. tenc sclivisite ; - <u>p.p. RUGINITA</u> -c.vant-X-lipsa- inloc. sudura L50x50x5+2cv-4 m	-50x50-h= 70	-30.	2	-	5,6	-amplas. in panta la 80m de drum pt care ;

TABEL CU DEFECTELE CONSTATATE SI LUCRARILE DE REPARATII LA STALPII LEA 110 kV COZLA - SF. ELENA - MOLDOVA NOUĂ (Anexa 1.a)

Nr. crt. /nr.st	TIP STALP	DIST. INTRE PICIOARE (m)	DEFECTE CONSTATATE LUCRARI DE EXECUTAT	DIMENS. CACIULA LxIxH(cm)	FELUL LUCRARII DE REPARATII				OBS.
					Curatat acces stalp (m ²)	SAPAT (m ³)	BETON -B200 (m ³)	TENCUIELI SCLIVISITE (m ²)	
0	1	2	3	4	5	6	7	8	9
153. /	Sn	2,6x2,6	-defrisari -30m ² ; sap. decop. caciuli st ; - ref. tenc sclivisite ; - <u>p.p. RUGINITA</u> -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5	-50x50-h= 90	-30.	2	-	7,2	-amplas. linga platf.pam.imprastiat ; - cca 30m
154. /	Sn+3	3,0x3,0	-defrisari -20m ² ; sap. decop. caciuli st ; - ref. tenc sclivisite ; - <u>p.p. RUGINITA</u> -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5	-50x50-h= 80	-20.	2	-	6,4	-amplas. in fata statiei 110kV Sf. Elena ;
			LEA 110kV Sf.ELENA-MOLDOVA Noua						
1.	ITn110244	5,4x5,4	-stalp zincat amplasat in curtea st. Sf. ELENA	-140x140-20					-amplasat in incinta statiei ; -lipsa placuta cu nr. stalp
2.	Sn	2,6x2,6	-defrisari -30m ² ; sap. sist.baza st. ; - ref. tenc sclivisite ; - <u>p.p. BUNA</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5-8m	-50x50-h= 80	-30.	3	-	6,4	-amplas. teren in panta
3.	Sn	2,6x2,6	-defrisari -30m ² ; sap. decop. caciuli st+rigola ev.apa ; - ref. tenc sclivisite ; - <u>p.p. BUNA</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5-8m	-50x50-h= 75	-30.	2	-	6,4	-acces greu, teren in panta ;
4.	Sn	2,6x2,6	-defrisari -30m ² ; sap. decop. caciuli st+rigole elim apa - ref. tenc sclivisite ; - <u>p.p. RUGINITA</u> -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5	-55x55-h= 70	-30.	3	-	6,2	-amplas. linga drum acces pt care
5.	Sn	2,6x2,6	-defrisari -30m ² ; sap. decop. caciuli st ; - ref. tenc sclivisite ; - <u>p.p. RUGINITA</u>	-55x55-h= 60	-30.	2	-	5,4	-amplas. linga drum asfaltat
6.	Sn	2,6x2,6	-defr. lastaris-30m ² ; sap. decop. caciuli si sist. baza st - ref. tenc sclivisite ; - <u>p.p. BUNA</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5	-60x60-h= 70	-30.	3	-	6,8	-amplas.-in cultura de porumb- la cca 30m drum pt care
7.	ITn110240	4,1x4,1	-defrisari lastaris-30m ² ; sap.1caciula+ elim apa ampl - ref. tenc sclivisite ; - <u>p.p. RUGINITA</u>	-65x65-h= 90	-30.	3	-	10,0	-amplas. linga drum
8.	Sn	2,6x2,6	-defrisari -40m ² ; sap. decop. caciuli st ; 2caciuli sparte - ref. tenc sclivisite ; - <u>p.p. BUNA</u> ; - baza st.ruginita-curtat de rugina si vopsit baza st.	-40x40-h= 50	-40.	3	0,4	4,8	-amplas. in teren privat, la cca 70m drum pt care; exista izvor in aprop.
9.	Sn	2,6x2,6	-defrisari -40m ² ; sap. decop. 1caciuli st ; caciula sparta - ref. tenc sclivisite ; - <u>p.p. BUNA</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5	-50x50-h= 50	-40.	2		5,0	-amplas. la cca 6m drum pt care; -zona cu alunecare de teren ;

TABEL CU DEFECTELE CONSTATATE SI LUCRARILE DE REPARATII LA STALPII LEA 110 KV COZLA - SF. ELENA - MOLDOVA NOUĂ (Anexa 1.a)

Nr. crt. /nr.st	TIP STALP	DIST. INTRE PICIOARE (m)	DEFECTE CONSTATATE LUCRARI DE EXECUTAT	DIMENS. CACIULA LxlxH(cm)	FELUL LUCRARII DE REPARATII				OBS.
					Curatat acces stalp (m ²)	SAPAT (m ³)	BETON -B200 (m ³)	TENCUIELI SCLIVISITE (m ²)	
0	1	2	3	4	5	6	7	8	9
10.	ICn110231	3,5x5,0	-defrisari -40m ² ; sap. decop. caciuli st ; caciula sparta si armatura corodata ; - ref. tenc sclivisite ; - <u>p.p. REFACERE</u> ;	-95x95-h= 100	-40.	2	0,5	16,0	-amplas. la cca 20m drum pt care;
11.	ICn110231	3,5x5,0	-defrisari -40m ² ; sap. decop. caciuli st +rigole apa ; - armat corodata -ref. tenc sclivisite ; - <u>p.p. REFACERE</u>	-95x95-h= 100	-40.	3	0.5	16,0	-amplas. teren in panta la cca 70m drum pt care;
12.	Sn	2,6x2,6	-defrisari -40m ² ; sap. decop. 1 caciuli st sparta - ref. tenc sclivisite ; - <u>p.p. BUNA</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 - baza st.ruginita-curtat de rugina si vopsit baza st.	-50x50-h= 70	-40. -900	2		6,0	-amplas. f.dificil, necesita culoar de acces ; -zona cu alunecare de teren ;
13.	Sn	2,6x2,6	-defrisari -40m ² ; sap. decop. caciuli st+rigole ape ; - ref. tenc sclivisite ; - <u>p.p. BUNA</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5	-60x40-h= 80	-40. -800	2		7,8	-amplas. f.dificil, necesita culoar de acces ;
14.	Sn	2,6x2,6	-defrisari -40m ² ; sap.rigole ape ; ; caciuli sparte - ref. tenc sclivisite ; - <u>p.p. BUNA</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 - baza st.ruginita-curtat de rugina si vopsit baza st.	-2-60x60-h= 80 -2-40x40-h=50	-40. -900	3		6,0	-amplas. f.dificil, necesita culoar de acces ;
15.	Sn	2,6x2,6	-defrisari -40m ² ; sap. decop.caciuli st.+rigole ape ; - ref. tenc sclivisite ; - <u>p.p. BUNA</u> ; -c.vantuire-X- se va SUDA	-50x50-h= 70	-40. -700	2		6,0	-acces usor la 5m de drum pt care ; -exista fantana in zona
16.	Sn	2,6x2,6	-defrisari -40m ² ; - ref. tenc sclivisite ; - <u>p.p. BUNA</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5 - baza st.ruginita-curtat de rugina si vopsit baza st.	-50x50-h= 70	-40.	-		6,0	-amplas. la cca 50m drum pt care
17.	ITn110240	4,1x4,1	-defrisari locale-30m ² ; - ref. tenc sclivisite ; - <u>p.p. in fundatie st.</u> ;	-60x60-h= 80	-30.	3	-	7,8	-amplas. linga drum pt care ;
18.	Sn	2,6x2,6	-defrisari -20m ² ; sap. decop. caciuli st+rigole ape ; - ref. tenc sclivisite ; - <u>p.p. REFACUTA</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5	-50x50-h= 60	-20.	2		5,0	- acces cu tractor ;
19.	Sn	2,6x2,6	-defrisari -30m ² ; sap. decop. 2caciuli st. ; - ref. tenc sclivisite ; - <u>p.p. REFACUTA</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5	-40x40-h= 80	-30.	2		5,0	-amplas. la cca 50m drum pt care ;
20.	Sn	2,6x2,6	-defrisari -20m ² ; sap. decop. caciuli st. ; - ref. tenc sclivisite ; - <u>p.p. RUGINITA</u> ;	-40x40-h= 50	-20.	2		5,0	-amplas. la 50m drum pt care ;

TABEL CU DEFECTELE CONSTATATE SI LUCRARILE DE REPARATII LA STALPII LEA 110 kV COZLA - SF. ELENA - MOLDOVA NOUĂ (Anexa 1.a.)

Nr. crt. /nr.st	TIP STALP	DIST. INTRE PICIOARE (m)	DEFECTE CONSTATATE LUCRARI DE EXECUTAT	DIMENS. CACIULA LxIxH(cm)	FELUL LUCRARII DE REPARATII				OBS.
					Curatat acces stalp (m ²)	SAPAT (m ³)	BETON -B200 (m ³)	TENCUIELI SCLIVISITE (m ²)	
0	1	2	3	4	5	6	7	8	9
21.	Sn	2,6x2,6	-defrisari -20m ² ; sap. decop. caciuli st+rigole ape ; - ref. tenc sclivisite ; - <u>p.p. BUNA</u> ;	-40x40-h= 50	-20.	2		5,0	-teren plan, acces usor cu tractor
22.	Sn	2,6x2,6	-defrisari -20m ² ; sap. decop. caciuli st+rigole ape ; - ref. tenc sclivisite ; - <u>p.p. BUNA</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5	-40x40-h= 50	-20.	3		5,0	-teren plan, acces usor cu tractor
23.	Sn	2,6x2,6	-defrisari -50m ² ; sap. decop. caciuli st+rigole ape ; - ref. tenc sclivisite ; - <u>p.p. RUGINITA</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5	-50x50-h= 50	-50.	3		5,0	-teren plan, acces usor cu tractor
24.	Sn	2,6x2,6	-defrisari -20m ² ; sap. decop. caciuli st ; - ref. tenc sclivisite ; - <u>p.p. RUGINITA</u> ; -c.vantuire-X-lipsa- inloc. cu sudura L50x50x5	-40x50-h= 50	-20.	2		5,0	-teren plan, acces usor cu tractor
25.	ITn110241	5,0x5,0	-defrisari -20m ² ; sap. decop. rigole ape ; - ref. tenc sclivisite ; - <u>p.p.RUGINITA</u> ;	-100x100- h=100	-20.	3		16,0	-teren plan, acces usor cu tractor
26.	ITn+3 110241	6,2x4,3	- sap. decop. caciuli ; - ref. tenc sclivisite ; - <u>p.p.RUGINITA</u> ; Sudura el.met -c.vant- 16m-lipsa- inloc. cu sudura L50x50x5	-70x70-h= 80	-20.	4		9,0	-teren plan, acces usor cu tractor
			TOTAL :		207.220	410	3	950	